

AI Reporting & Analytics — Actionable Insights, Instantly

Solar Farm Inspection Report — May 2025

4,218 Panels Inspected	37 Defects Found	8 Critical
----------------------------------	----------------------------	----------------------

DEFECTS BY TYPE



DEFECT MAP




Anomaly ID: 3

CRITICAL

Site Anomaly Report

Thermal & Visual Analysis

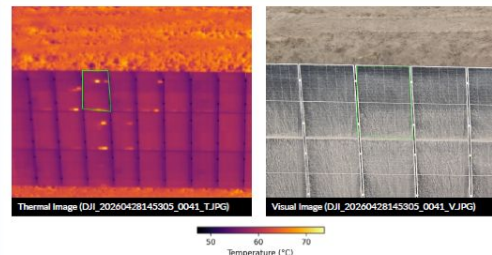

Anomaly Details

Anomaly Type	Multi hotspots
Anomaly Cause	Soiling or dirt
Severity	Critical
Panel-No	26-1-4-A

Temperature Analysis

Min Temperature	17°C
Max Temperature	85°C
Mean Temperature	48.46°C
Delta Temperature	41°C

Recommended Action

Due: ASAP

Perform field inspection and cleaning. Measure module electrical parameters to check for performance loss. Monitor the module over time for any negative changes.

Compatible
camera of